

## Integra<sup>AX</sup> 3.8 Release Notes

### Description

#### Issues fixed in Niagara 3.8 Update 4 Release

#### Release Notes not assigned to module

<b>NC CB-34444</b>	Platform Application Director disconnects on 500ms timeout
A new system property has been added for Niagara Daemon platform connections that will permit extending the timeout associated with reading the output streams of the Niagara Station and Niagara Daemon. The property is "niagara.daemonsession.streamtimeout". The default value is 500ms and can be extended with changes to system.properties.	

#### Release Notes assigned to one or more modules

<b>NC CB-30546</b>	ccnDriver	Ax CCN Numeric override never stops writing
Once a Ccn NumericWritable was overridden it would continue to rewrite the value forever.		

<b>NC CB-32758</b>	platCrypto	Web Start does not use allowed certs to make HTTPS Connection
Previously, certificates could not be approved for TLS connections from the Applet or Web start. This has been corrected, and a prompt will be shown to allow the approval of invalid certificates.		

<b>NC CB-33245</b>	weather	Ax Weather Service does not follow redirects
Previous versions of the AX Weather service were unable to follow URI redirects in the National Weather Service provider. This resulted in a failure to load the current conditions. This has been corrected.		